

AS/NZS 3718

Product Installation Guidelines

Version 3, 4 June 2024, Page 1 of 3 Document No: 001.00.30.29

Ezy-Push® CP-BS Lead Safe™ Timeflow Push Button Replacement Cartridge PRODUCT CODES:

- 173.92.25.00 For Hand Wash 6 sec.
- 173.92.35.00 For Hand Wash 10 sec.

SPECIFICATIONS

- Our range of AS/NZS 3718 approved Ezy-Push® Push Button tapware is reliable and durable.
- It is designed to suit the increasing need for the conservation of water and the minimisation of vandalism.
- Constructed from dezincification resistant brass Ezy-Push® Push Button tapware delivers a constant flow irrespective of pressure to provide a controlled stream.
- The cartridges are made of Lead Safe™ DR Brass*.

IMPORTANT: All Ezy-Push® Time Flow Pillar Taps are tested in accordance with AS/NZS 3718 and leave our premises in good working order. Time may vary due to changes in temperature, pressure, flow rate and water quantity.

*Our Lead Safe™ product range is compliant with the Lead Free Requirements of the NCC 2022 Vol. Three, Clause A5G4(2) and NSF/ANSI 372.


TECHNICAL DATA			
Assembly Thread		M26 x19 TPI - Male	
Outlet		N/A	
Headwork		Time Flow Cartridge	
Working Pressure Range (kPa)	Min	50	
	Max	500	
Working Temperature (°C)	Min	5	
	Max	65	
Nominal Flow Rate (LPM)		N/A	
Construction		Brass	
Finish		Chrome	

TOOLS REQUIRED

24mm Spanner


INSTALLATION

IMPORTANT: Galvin Engineering products must be installed in accordance with these installation instructions and in accordance with AS/NZS 3500, the PCA and your local regulatory requirements. Water and/or electrical supply conditions must also comply to the applicable national and/or state standards. Failing to comply with these provisions shall void the product warranty and may affect the performance of the product.

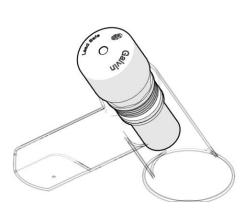


1. Turn off water supply

Prior to installation, turn off water supply.

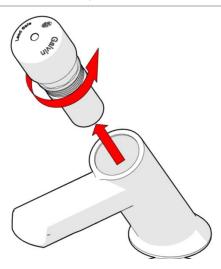


2. Remove Timeflow Cartridge

Unscrew the timeflow cartridge using a 24mm spanner.

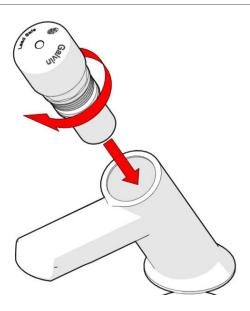

3. Replace Timeflow Cartridge

- Fit the new timeflow cartridge using a 24 mm spanner.

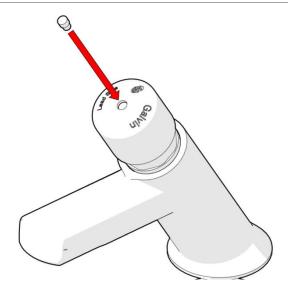

4. Place indicator and inspect

- Fit color indicator hot (red), cold (blue) or warm (yellow) as required on the cap ('New Style' only).
- When installation is complete, slowly open water supply and inspect for leaks.

TROUBLESHOOTING		
PROBLEM	CAUSE	RECTIFICATION
Taps are dripping water	Dirt/Debris in cartridge	Remove and clean cartridge
	Faulty cartridge	Replace cartridge
Water is not flowing from tap	Water is turned off	Turn on water
	Aerator or flow restrictor is blocked by debris	Remove aerator and/or flow restrictor from tap and remove debris. Install an in-line strainer.

WARRANTY

Galvin Engineering products are covered under our Manufacturer's Warranty. Galvin Engineering products must be installed in accordance with the installation instructions and in accordance with AS 3500 and NCC Volume Three, relevant Australian Standards and local authorities applicable to product being installed. Water and electrical supply conditions must also comply to the applicable national and/or state standards, failing to comply with these provisions may void the product warranty and affect performance of the product.

Please visit <u>www.galvinengineering.com.au</u> to view the full warranty, our Installation Compliance and Maintenance & Cleaning information as well as any other additional information.

Within Australia: 1300 514 074 Outside Australia: P: +61 (0)8 9338 2344

F: +61 (0)8 9338 2340

sales@galvinengineering.com.au www.galvinengineering.com.au

ABN: 78 008 719 382

PERTH I SYDNEY I MELBOURNE I BRISBANE I ADELAIDE



